

OWNERSHIP STENCILING

DETAIL No. 1

DETAIL No. 2

DETAIL No. 3

DETAIL No. 4

THE TRAVELERS
INSURANCE COMPANY,
OWNER

BANK OF AMERICA
NATIONAL TRUST AND SAVINGS
ASSOCIATION, OWNER

THE CHASE MANHATTAN
BANK, OWNER

BANKERS TRUST COMPANY,
OWNER

BLACK BACKGROUND WITH 1 1/2" YELLOW LETTERS.

THIS CAR EQUIPPED WITH
40 CROSSMEMBERS DF-202112
8 DOORWAY MEMBERS DF-200367
10-48 INTERLOCKING DECKBOARDS
FASTEN AND SECURE ALL
LOOSE EQUIPMENT.

LOCATE ON END
LINING - A END

DF EQUIPMENT STENCIL ON INSIDE OF CAR AT L.H. SIDE OF EACH DOOR

OWNERSHIP STENCILING
FOR WORDING SEE DETAIL.

INITIALS AND CAR NUMBERS TO BE
STENCILED ON INSIDE OF BOTH DOORS
BOTH SIDES OF CAR IN YELLOW.

INITIALS AND CAR NUMBERS TO BE
STENCILED ON INSIDE OF CAR ON
SIDE PLT REINF. - BOTH SIDES OF CAR
IN YELLOW.


SIDES & ENDS OF CAR
TO BE BOX CAR RED.

NOTE:
THE FOLLOWING DRAWINGS OF LETTERS AND
NUMERALS TO APPLY-

624-F-340 2" BLOCK LETTERS AND NUMERALS.
624-F-300 3" BLOCK LETTERS AND NUMERALS
623-F-310 4" BLOCK NUMERALS
624-F-350 4" BLOCK LETTERS
624-F-360 7" BLOCK NUMERALS.
624-F-330 9" BLOCK LETTERS "P TO W"
628-F-350 12" BLOCK LETTERS.
623-F-300 REPACK DATE STENCIL

THIS CAR IS EQUIPPED WITH A
NAILABLE STEEL FLOOR
USE 16 OR 20 PENNY NAILS
TO SECURE BLOCKING
BY NAILING INTO GROOVES

STEEL FLOOR STENCIL
(SEE TABLE)

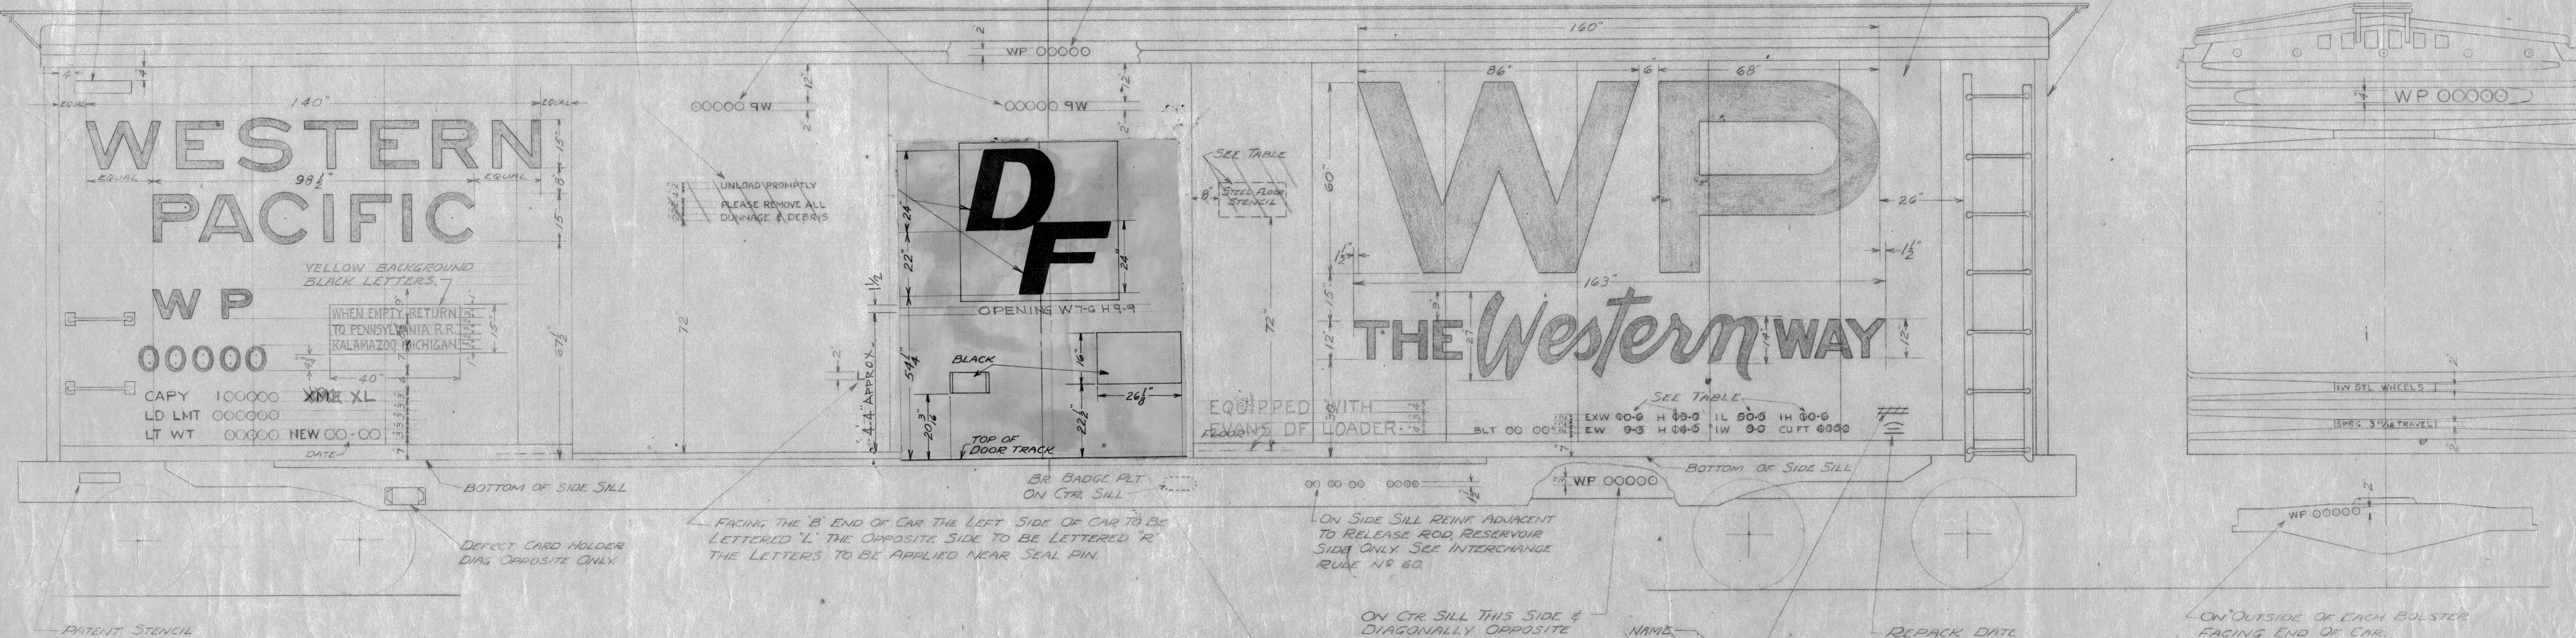

PATENT STENCIL

BOTTOM OF SIDE SILL

DEFECT CARD HOLDER
DING OPPOSITE ONLY.

FACING THE 'B' END OF CAR THE LEFT SIDE OF CAR TO BE
LETTERED 'L' THE OPPOSITE SIDE TO BE LETTERED 'R'
THE LETTERS TO BE APPLIED NEAR SEAL PIN.

BR BADGE PLT.
ON CTR. SILL

ON SIDE SILL REINF. ADJACENT
TO RELEASE ROD, RESERVOIR
SIDE ONLY. SEE INTERCHANGE
RULES N 60.

ON CTR. SILL THIS SIDE &
DIAGONALLY OPPOSITE

FIBERGLAS INSULATION IN ENDS

NAME

000000
LUBRICATORS



LUBRICATOR STENCIL
(CARD F-1355 ONLY)

REPACK DATE
PER DWG 623-F-300
CARD F-300

ON OUTSIDE OF EACH BOLSTER
FACING END OF CAR.

NOTE 1: ALL LETTERING & MARKINGS TO BE YELLOW MATCHING
THAT COVERED BY W.P. SPEC. 5-12 ON OUTSIDE - BLACK
ON INSIDE OF CAR.

NOTE 2: ALL LETTERS & FIGURES 3" OR OVER IN HEIGHT ARE
TO BE SOLID AND NOT DISCONNECTED AT BRIDGES.

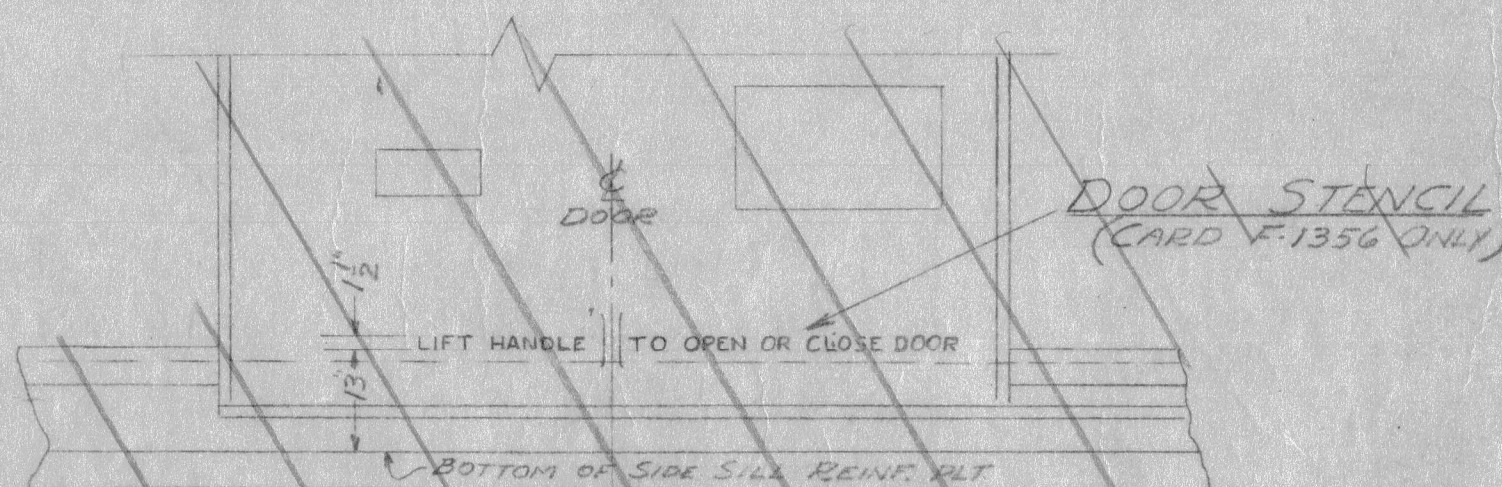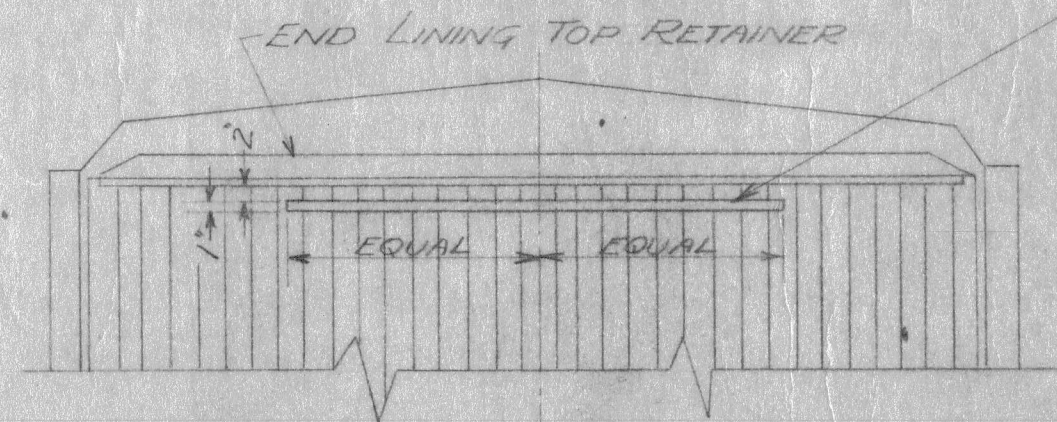

OFFICE COPY

DET. No.	WITHOUT	4840	10'5"	9'2"	50'5"	14'5"	9'4"	13'8"	10'4"	Box 3007	F-1440
DET. No. 3	WITHOUT	4840	10'5"	9'2"	50'5"	14'5"	9'4"	13'7"	10'6"	BOX 35501-35625	F-1356
DET. No. 2	WITHOUT	4840	10'5"	9'2"	50'5"	14'5"	9'4"	13'7"	10'6"	BOX 35501-35625	F-1355
DET. No. 4	WITH	4840	10'5"	9'2"	50'5"	14'5"	9'5"	13'7"	10'6"	BOX 35401-35425	F-1354
DET. No. 4	WITHOUT	4840	10'5"	9'2"	50'5"	14'5"	9'5"	13'7"	10'6"	BOX 35301-35400	F-1353
DET. No. 3	WITHOUT	4840	10'5"	9'2"	50'5"	14'5"	9'5"	13'7"	10'6"	BOX 35201-35300	F-1352
DET. No. 2	WITHOUT	4840	10'5"	9'2"	50'5"	14'5"	9'5"	13'7"	10'6"	BOX 35101-35182	F-1351
DET. No. 1	WITHOUT	4840	10'5"	9'2"	50'5"	14'5"	9'5"	13'7"	10'6"	BOX 35001-35090	F-1350
OWNERSHIP STENCILING	CU. FT.	1H	1W	1L	1EH	1EW	1H@EXW	1EXW			

WESTERN PACIFIC RAILROAD CO.
MECHANICAL DEPT.
PAINTING & STENCILING
ARRANGEMENT

3379 A DR. RWC, CH. MYUB AP. NEW
REVISED DATE: MAY 12, 1950 624-F-1440

259

This file (624-F-1440_Painting_and_Stenciling_Boxcars_3007.pdf) was posted to
WPLives.org at Sun Aug 2 08:15:57 AM PDT 2026